



Weldmatic W65 4RD Heavy Duty Wirefeeder + Weldmatic W66 4RD Wirefeeder



Weldmatic W65 4RD
Heavy Duty Wirefeeder
Model No. W65-0,
Iss A



Weldmatic W66 4RD
Wirefeeder
Model No. W66-0
Iss A

Operators Manual 02/16



Welding Industries of Australia

A division of ITW Australia Pty Ltd

1300 300 884

Info@welding.com.au

welding.com.au



Trusted by the best



Contents

Section	General information	Page
	Safe practices	2
1	Introduction	5
2	Receiving	5
3	Specifications	6
4	Controls	6
5	Installation	9
6	Basic Welding Information	10
7	General Maintenance	10
8	External Trouble Shooting	11
9	Service Information	
	9.1 Circuit Diagram	13
10	Assembly and Parts Lists	
	10.1 W65 Wirefeeder	14
	10.2 W66 Wirefeeder	16
	10.3 Wirefeed Assembly	18
	10.4 Gun and Cable Assembly	19
	10.5 Work Lead & Interconnecting Lead Kit	21
11	Warranty information	23



Read First

The information contained in this manual is set out to enable you to properly maintain your new equipment and ensure that you obtain maximum operating efficiency.

Please ensure that this information is kept in a safe place for ready reference when required at any future time.

When ordering spare parts, please quote the model and serial number of the power source and part number of the item required. All relevant numbers are shown in lists contained in this manual. Failure to supply this information may result in unnecessary delays in supplying the correct parts.

Safety

Before this equipment is put into operation, please read the Safe Practices section of this manual. This will help to avoid possible injury due to misuse or improper welding applications.

Plastic Handles on Power Source

Please note that the handles fitted to the Weldmatic power source are intended for carrying the equipment by hand only.

DO NOT use these handles for suspending or mounting the power source in any other manner.

Safe Practices When Using Welding Equipment

These notes are provided in the interests of improving operator safety. They should be considered only as a basic guide to Safe Working Habits. A full list of Standards pertaining to industry is available from the Standards Association of Australia, also various State Electricity Authorities, Departments of Labour and Industry or Mines Department and other Local Health or Safety Inspection Authorities may have additional requirements. Australian Standard AS1674.2 provides a comprehensive guide to safe practices in welding.

Eye Protection

NEVER LOOK AT AN ARC WITHOUT PROTECTION. Wear a helmet with safety goggles or glasses with side shields underneath, with appropriate filter lenses protected by clear cover lens. This is a **MUST** for welding, cutting, and chipping to protect the eyes from radiant energy and flying metal. Replace the cover lens when broken, pitted, or spattered.

Recommended Shade Filter Lens

Amps	TIG	MMAW	MIG	Pulsed MIG
0-100	10	9	10	12-13
100-150	11	10	10	12-13
150-200	12	10-11	11-12	12-13
200-300	13	11	12-13	12-13
300-400	14	12	13	14
400-500	—	13	14	14
500 +	—	—	14	14

Burn Protection

The welding arc is intense and visibly bright. Its radiation can damage eyes, penetrate light-weight clothing, reflect from light-coloured surfaces, and burn the skin and eyes. Burns resulting from gas-shielded arcs resemble acute sunburn, but can be more severe and painful.

Wear protective clothing - leather or heat resistant gloves, hat, and safety-toe boots. Button shirt collar and pocket flaps, and wear cuffless trousers to avoid entry of sparks and slag.

Avoid oily or greasy clothing. A spark may ignite them. Hot metal such as electrode stubs and work pieces should never be handled without gloves.

Ear plugs should be worn when welding in overhead positions or in a confined space. A hard hat should be worn when others are working overhead.

Flammable hair preparations should not be used by persons intending to weld or cut.

Toxic Fumes

Adequate ventilation with air is essential. Severe discomfort, illness or death can result from fumes, vapours, heat, or oxygen depletion that welding or cutting may produce. **NEVER** ventilate with oxygen.

Lead, cadmium, zinc, mercury, and beryllium bearing and similar materials when welded or cut may produce harmful concentrations of toxic fumes. Adequate local exhaust ventilation must be used, or each person in the area as well as the operator must wear an air-supplied respirator. For beryllium, both must be used.

Metals coated with or containing materials that emit fumes should not be heated unless

coating is removed from the work surface, the area is well ventilated, or the operator wears an air-supplied respirator.

Work in a confined space only while it is being ventilated and, if necessary, while wearing air-supplied respirator.

Vapours from chlorinated solvents can be decomposed by the heat of the arc (or flame) to form phosgene, a highly toxic gas, and lung and eye irritating products. The ultra-violet (radiant) energy of the arc can also decompose trichlorethylene and perchlorethylene vapours to form phosgene. Do not weld or cut where solvent vapours can be drawn into the welding or cutting atmosphere or where the radiant energy can penetrate to atmospheres containing even minute amounts of trichlorethylene or perchlorethylene.

Fire and Explosion Prevention

Be aware that flying sparks or falling slag can pass through cracks, along pipes, through windows or doors, and through wall or floor openings, out of sight of the operator. Sparks and slag can travel up to 10 metres from the arc.

Keep equipment clean and operable, free of oil, grease, and (in electrical parts) of metallic particles that can cause short circuits.

If combustibles are present in the work area, do NOT weld or cut. Move the work if practicable, to an area free of combustibles. Avoid paint spray rooms, dip tanks, storage areas, ventilators. If the work can not be moved, move combustibles at least 10 metres away out of reach of sparks and heat; or protect against ignition with suitable and snug-fitting fire-resistant covers or shields.

Walls touching combustibles on opposite sides should not be welded on or cut. Walls, ceilings, and floor near work should be protected by heat-resistant covers or shields.

Walls touching combustibles on opposite sides should not be welded on or cut. Walls, ceilings, and floor near work should be protected by heat-resistant covers or shields.

A person acting as Fire Watcher must be standing by with suitable fire extinguishing equipment during and for some time after welding or cutting if;

- Combustibles (including building construction) are within 10 metres.
- Combustibles are further than 10 metres but can be ignited by sparks.
- Openings (concealed or visible) in floors or walls within 10 metres may expose combustibles to sparks.
- Combustibles adjacent to walls, ceilings, roofs, or metal partitions can be ignited by radiant or conducted heat.

After work is done, check that area is free of sparks, glowing embers, and flames.

A tank or drum which has contained combustibles can produce flammable vapours when heated. Such a container must never be welded on or cut, unless it has first been cleaned as described in AS.1674-2. This includes a thorough steam or caustic cleaning (or a solvent or water washing, depending on the combustible's solubility), followed by purging and inerting with nitrogen or carbon dioxide, and using protective equipment as recommended in AS.1674-2. Water-filling just below working level may substitute for inerting.

Hollow castings or containers must be vented before welding or cutting. They can explode. Never weld or cut where the air may contain flammable dust, gas, or liquid vapours.

Shock Prevention

Exposed conductors or other bare metal in the welding circuit, or ungrounded electrically alive equipment can fatally shock a person whose body becomes a conductor. Ensure that the equipment is correctly connected and earthed. If unsure have the equipment installed by a qualified electrician. On mobile or portable equipment, regularly inspect condition of trailing power leads and connecting plugs. Repair or replace damaged leads.

Fully insulated electrode holders should be used. Do not use holders with protruding screws. Fully insulated lock-type connectors should be used to join welding cable lengths.

Terminals and other exposed parts of electrical units should have insulated knobs or covers secured before operation.

If the supply cable is damaged it must be replaced by the manufacturer, their service agent or a similarly qualified person.

1 Introduction

Gas Metal Arc Welding (G.M.A.W.) is an arc welding process where a consumable wire is fed by motor driven feed rolls to a welding gun, and where welding current is supplied from the welding power source. The welding arc is struck between the work piece and the end of the wire, which melts into the weld pool. The arc and the weld pool are both shielded by gas flow from the gun, or in the case of "self shielded" wires, by gases generated by the wire core.

The process is very versatile in that by selection of the correct wire composition, diameter and shielding gas, it can be used for applications ranging from sheet-metal to heavy plate, and metals ranging from carbon steel to aluminium alloys.

The Weldmatic W65 Heavy Duty 4RD has been designed to be used with consumable wire in the range from 0.8mm to 1.6mm diameter. The Weldmatic W66 4RD has been designed to be used with consumable wires in the range from 0.6mm to 1.2mm diameter. The smaller wire sizes are used when welding at lower currents, such as sheet-metal applications. Increasing the wire diameter permits higher welding currents to be selected.

A common application of G.M.A.W. is for welding Mild Steel. In this application, a Mild Steel solid consumable wire such as AUSTMIG ES6 is used with a shielding gas of Carbon Dioxide, or Argon mixed with Carbon Dioxide. Alternatively, Flux-cored consumable wires are available in both gas shielded, and 'gasless' self shielding types.

Stainless steel and Aluminium can be welded with G.M.A.W. using the correct consumable wire and shielding gas.

The Weldmatic 4RD wirefeeder has been designed to feed a range of hard, soft, and flux-cored wires for the G.M.A.W. process. A compact motor with integral gear box is coupled to a 4 roll drive assembly forming the basic component of the wirefeeder. The motor is controlled by an electronic speed control which provides speed regulation and compensation for supply voltage variations.

2 Receiving

Check the equipment received against the shipping invoice to make sure the shipment is complete and undamaged. If any damage has occurred in transit, please immediately notify your supplier.

The package contains;

- Weldmatic 4RD Wirefeeder
- (This) Operating Manual W65-40.

If the 4RD Wirefeeder is included in a package with a Weldmatic MIG welder, it will also contain the following;

- Interconnecting leads
- Welding gun and cable assembly (see Section 10.4 for details)
- Work lead
- Gas hose
- Argon/mixed gas regulator/flow gauge.

3 Specifications

Wirefeeder

Supply Voltage

32 volts AC, (from welding power source)

Rated Supply Current

5 Amps

Pre-gas Range

0 - 2 seconds

Post-gas Range

0 - 2 seconds

Start Speed

Normal or Creep (switchable)

Spool Sizes

5 kg, 15 kg

Wirespeed Range

W65: 0 - 159 RPM

W66: 0 - 172 RPM

0 - 20 Metres per min

(0 - 10 Metres per min Low Speed Range,

8 - 20 Metres per min High Speed Range)

Wire Size Range

0.6mm - 1.6mm diameter

4 Controls

1 Power on Indicator

This indicator is illuminated when wirefeeder is connected to a power source and the power source is switched on.

2 Arc start

This control can be set to modify arc starting conditions. For many applications the control can be set at the mid point.

Rotating the knob towards 'FAST' will provide faster wire acceleration at arc start giving quicker starts, suitable for applications such as rapid tack welding.

Rotating the knob towards 'SOFT' will slow wire acceleration, providing a softer start suitable for larger diameter and aluminium wires.

3 Wire Speed Control

This control sets the speed of the wire drive motor equivalent to 0 - 20 metres per minute of welding electrode wire. Rotate the control clockwise to increase the feed speed.

This control is used in conjunction with the Wire Speed Range Select Switch. Switch to low for slower (0-10 metres/min wirespeed control and switch to high for higher (8-20 metres/min) wire speeds.

4 Wire Speed Range Indicator Light

This indicator is illuminated when speed range is set to High speed range (8-20 metres/min).

5 Wire Speed Range Select Switch

Press to change from Low wire speed range to High wire speed range.



Fig 1 Controls on Front Face of Wirefeeder

6 Purge Button

Press to open the gas solenoid valve without energising the welding power source.

7 Inch Button

Press to feed wire without energising the welding power source. The wire will feed at the current wirespeed setting.

8 Latch Select Button and Indicator

Press to select and deselect 'Latch' mode. When 'Latch' mode is selected, the operator need close the gun switch momentarily only to commence welding, and again momentarily to end welding. This can help to reduce operator fatigue during long welding runs.

9 Creep Select Button and Indicator

'Creep' is selected when welding more difficult materials such as aluminium or stainless steel. In 'Creep' mode, the wire is fed slowly until contact is detected and then accelerated to the selected speed. Because the wire comes into contact with the work slowly the arc establishes smoothly.

This is followed by rapid acceleration so that the arc does not flare up and damage the tip.

Even if an arc is not established, within one second of the gun switch being operated the wire feed accelerates to selected welding speed.

10 Voltage Control

This control is used to set the welding voltage. The setting is displayed on the power source digital display.

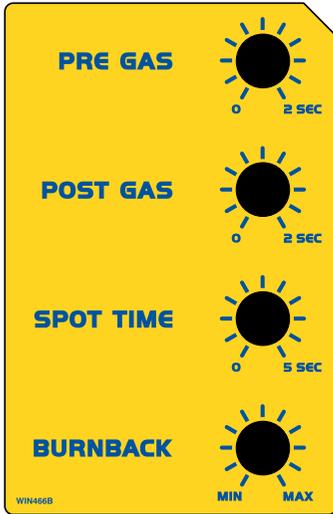


Fig 2 Controls Inside Wirefeeder

Wirefeeder Controls on Inside Panel

Pre Gas Control

Sets the time period of gas flow from gun switch on until welding commences, and can be set for 0 – 2 seconds.

Post Gas Control

This sets the time period of gas flow after welding ceases, and can be set for 0 – 2 seconds.

Spot Time Control

When the setting is other than fully anti clockwise, the welder will operate for a short time after each trigger press. Turn clockwise to increase the weld duration up to a maximum of 5 seconds.

Burnback Control

This control sets the time period that welding voltage continues after the gun switch is released, and wirefeed ceases. The extra time allows the wire to “burn back” slightly toward the tip.

5 Installation

Remote Wirefeeder

The remote wirefeeder is connected to the Weldmatic power source via the composite cable interconnecting lead. Check all connections are firmly made to ensure good electrical contact, and to prevent gas leaks.

Ensure correct size and type of drive roll is fitted.

Fitting The Gun and Cable Assembly

The supplied welding gun/cable assembly is equipped with a 'Euro' wirefeeder connector which incorporates all required connection points for welding current, shielding gas and gun switch control.

To attach the gun/cable assembly to the wirefeeder mechanism, engage the mating parts of the male and female Euro connectors, then rotate the locking ring clockwise to firmly secure the connection.

Fitting the Consumable Wire

The quality of the consumable wire greatly affects how reliably a gas metal arc welder will operate. For best results when welding mild steel, we recommend quality WIA AUSTMIG ES6. Dirty, rusty or kinked wire will not feed smoothly through the gun cable and will cause erratic welding. Deposits from the wire will clog the gun cable liner requiring it to be replaced prematurely.

Place the spool of welding wire onto the spool holder. The location pin should mate with a hole provided on the wire spool body.

Secure the spool with plastic nut. Check the adjustment of the spool brake, which should be set to prevent over run of the wire spool at the end of a weld, without unduly loading the wirefeed motor. The braking can be adjusted by using an allen key to adjust Hex head bolt inside the hub.

Feeding the Consumable Wire

At the wirefeeder, release the compression screw and rotate the top roller arms to the open position. The end of the welding wire can now be passed through the inlet guide, over the first lower roller, through the intermediate guide, over the second lower roller and into the output wire guide tube. Check that the drive roll grooves are correct for the wire in use. The appropriate size is stamped on the visible side of the installed rollers. Check also that the correct size contact tip is fitted at the gun end. Feed roller and tip details are shown in Section 10 of this manual.

Return the top roller arms to the closed position and adjust the compression screw to provide sufficient clamping of the drive rollers to achieve constant wirefeed. Do not over tighten.

With the equipment energised, operate the gun switch to feed wire through the gun cable.

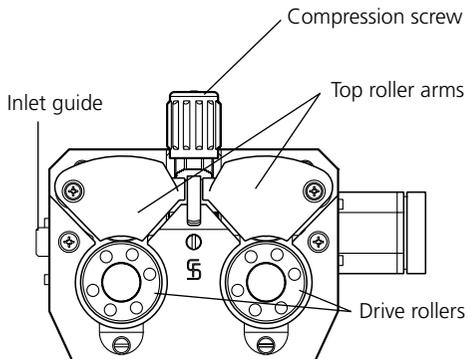


Fig 3 WF042 Four Roll Drive

6 Basic Welding Information

Refer to the Weldmatic power source Operators Manual for gas and weld setting and gun position information.

7 General Maintenance

Before removing the equipment cover, ENSURE that the equipment is disconnected from the mains power supply. When the equipment is energised LETHAL VOLTAGES are present.

Dust

Care should be taken to prevent excessive build-up of dust and dirt within the welding power source. It is recommended that at regular intervals, according to the prevailing conditions, the equipment covers be removed and any accumulated dust be removed by the use of dry, low pressure compressed air, or a vacuum cleaner.

Wirefeed

In order to obtain the most satisfactory welding results from the G.M.A.W. process, the wirefeed must be smooth and constant. Most causes of erratic wirefeed can be cured by basic maintenance. Check that the:

- 1 Feed rolls are the correct size and type for the wire in use. Check also that the drive groove is aligned with the wire and that the groove is not worn;
- 2 Gun cable liner is clear of dust and swarf build-up. When replacement becomes necessary, fit only the correct liner (see page 15). The build-up of dust can be minimised by regular purging of the liner with dry compressed air. This may be conveniently done each time the wire spool is replaced;
- 3 Welding tip is free of obstructions such as spatter build-up. Ream out the tip bore with a suitable size oxy-tip cleaner. Replace the welding tip as it becomes worn;
- 4 Feed roll pressure is not excessive. The pressure should be just sufficient to feed the wire evenly. Excessive pressure will deform the electrode wire and make feeding more difficult;
- 5 Consumable wire spool holder rotates smoothly and that the braking action is not excessive. The spool should only have sufficient braking to prevent over run when the motor stops. This also may be conveniently checked each time the wire is replenished;
- 7 Welding wire is straight and free of buckles or 'waviness'. To check, remove 2 or 3 metres of wire from the spool. Clamp one end in a vice or similar, then holding the other end pull the wire out straight. Look down the length of the wire, any buckles will be obvious. Buckled wire is extremely difficult to feed reliably and should be replaced;
- 8 Welding wire is free of surface rust. Replace if rust is evident.

8 External Trouble Shooting

Refer to the Weldmatic power source Operators Manual for trouble shooting tips. If these checks do not identify the fault condition, the equipment should be returned to a WIA Service agent. Phone 1300 300 884 for details of your nearest service agent.

9 Service Information

The following information is intended for use by qualified service personnel. When the unit is energised LETHAL VOLTAGES are present on the electrical and electronic components. It is not intended that persons without suitable training and knowledge attempt to perform service tasks on the components of this welder.

Before removing the equipment cover, ENSURE that the equipment is disconnected from the mains power supply. When the equipment is energised LETHAL VOLTAGES are present on the electrical components enclosed.

9.1 W65 + W66 Wirefeeder Circuit Diagram

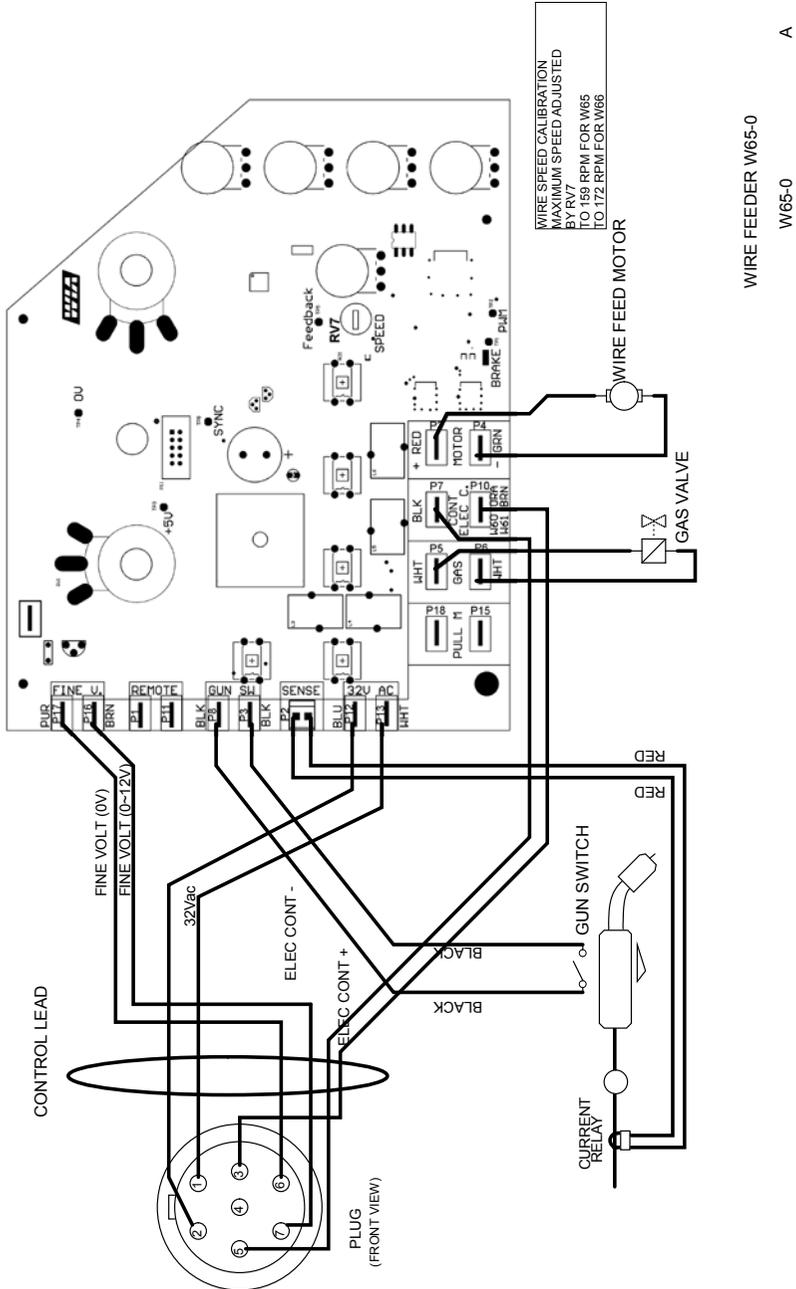


Fig 4 W65 +W66 Wirefeeder Circuit Diagram

10.1 Assembly and Parts List - W65 Wirefeeder



Fig 5 W65 Wirefeeder Assembly

Item #	Part #	Description	Qty
1	WF057	Wirefeed Assembly and Motor	1
2	WF052	Euro Adaptor	1
3	WF065	Euro Housing Plastic	1
4	WIN576	Front Panel Sticker	1
5	M0047	Knob	2
6	M0078	Panel Front Plastic	1
7	WF066	Spool Cover	1
8	M0077	Hinge	2
9	M0062	Latch	1
10	M0044	Spool Holder Complete	1
11	M0046	Spool Holder Nut (included in M0044)	1
	E0041	Gas Valve	1
	PWA038	Wirefeed PCB	1

10.1 Assembly and Parts List - W65 Wirefeed Assembly and Motor

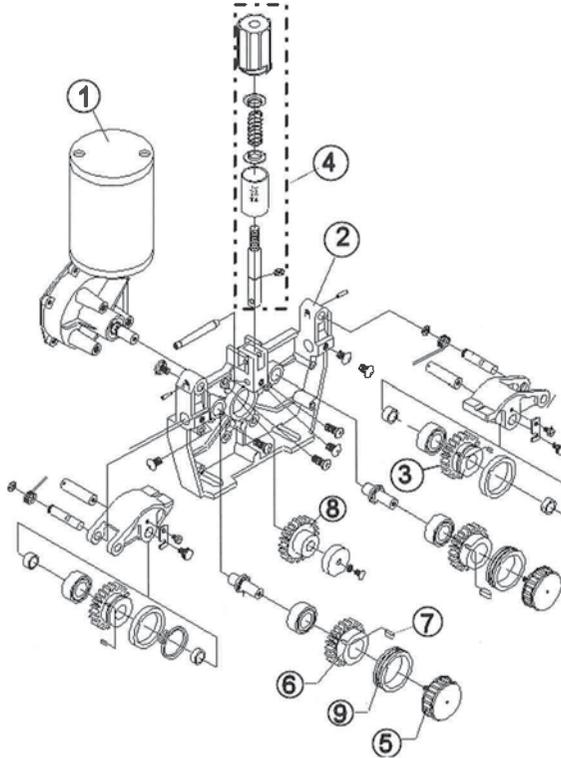


Fig 6 W65 Wirefeeder Assembly and Motor

Item #	Part #	Description	Qty
1	WF069	Motor	1
2	WF058	Wirefeed Assembly	1
3	WF059	Top Roller Gear	2
4	WF060	Tension Adjustment Screw	1
5	WF061	Bottom Roller Retention Screw	2
6	WF062	Bottom Roller Gear	2
7	WF063	Bottom Roller Key	2
8	WF064	Motor Drive Gear	1
9	WF070	Feed rolls 0.9 + 1.2 mm, Solid Wire (fitted)	2
	WF071	1.2 + 1.6 mm, Solid Wire	2
	WF072	1.0 + 1.2 mm, Aluminium	2
	WF073	1.0 + 1.2 mm, Flux Cored Wire	2
	WF074	1.2 + 1.6 mm, Flux Cored Wire	2

10.2 Assembly and Parts List - W66 Wirefeeder

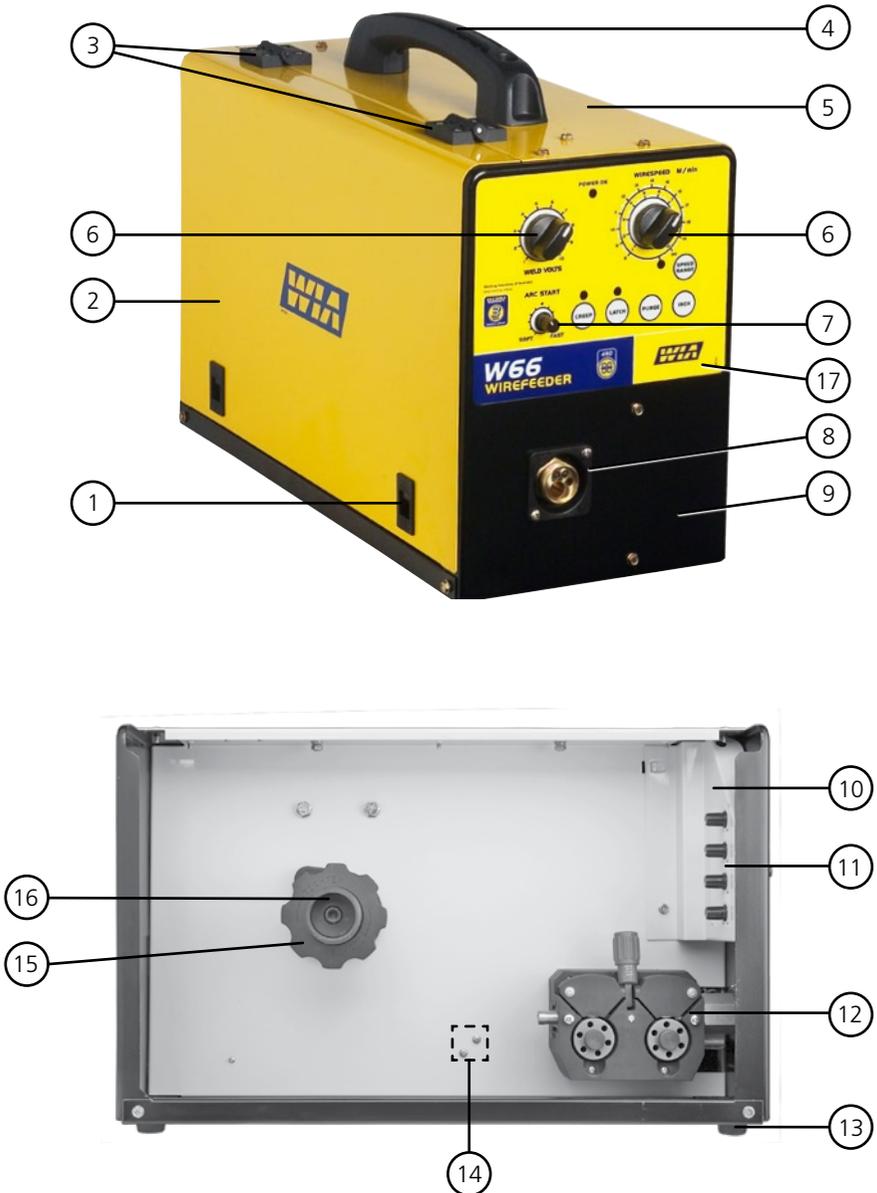


Fig 7 W66 Wirefeeder Assembly

W66 Wirefeeder Parts List

Item #	Part #	Description	Qty
1	M0049	Slam Action Catch	2
2	PAN123	Door	1
3	M0041	Hinge Set	2
4	M0042	Handle	1
5	PAN124	Top / Side Panel	1
6	M0047	Adjusting Knob, Large	2
7	E0016	Adjusting knob, Small	5
8	WF001-6	Euro Surround, Plastic	1
9	PAN126	Front Panel	1
10	PAN125	PCB Cover	1
11	PWA038	Wirefeed Control Printed Circuit Assembly	1
		includes Potentiometer, Wirespeed Control (1K), Voltage Control (1K)	1
12	WF042	Four Roll Drive and Euro Adaptor Assembly (see page 14)	1
13	M0043	Rubber Foot	4
14	E0041	Gas Valve 24 vdc	1
15	M0046	Spool Retaining Nut	1
16	M0044	Spool Holder Assembly (incl nut)	1
17	WIN577	Front Panel Sticker	1
Not shown	AM343	Current Sensor	1

10.3 Assembly and Parts List - WF042 Wirefeed Assembly

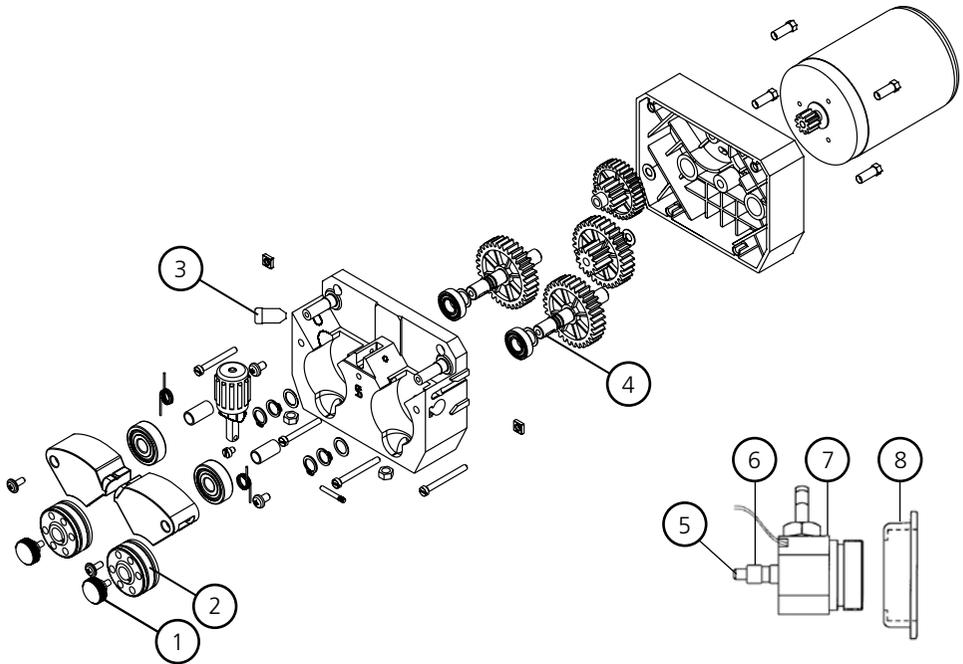


Fig 8 Wirefeed Assembly

Item #	Part #	Description	Qty
1	WF045	Roller Retaining Screw	2
2	WF027	0.9 + 1.2 mm, Solid Wire (fitted)	2
	WF026	0.6 + 0.8 mm, Solid Wire	2
	WF028	1.2 + 1.6 mm, Solid Wire	2
	WF029	1.0 + 1.2 mm, Aluminium	2
	WF030	1.0 + 1.2 mm, Flux Cored Wire	2
	WF031	1.2 + 1.6 mm, Flux Cored Wire	2
3	W26-0/13	Inlet Guide	1
4	W26-0/4	Woodruff Key	2
5	WF001-21	Outlet Guide Tube (oversize, cut to 41mm long)	1
6	WF038	Positioning Shaft, Brass	1
7	WF044	Euro Adaptor incl. Gas Barb Positioning Shaft & Guide Tube	1
8	WF001-6	Plastic Euro Cover	1
9	WF049	4 Roll Drive Box Assembly incl. Front & Rear Plastic Housing & Pressure Screw Complete	1

10.4 Assembly and Parts List - Gun and Cable Assembly

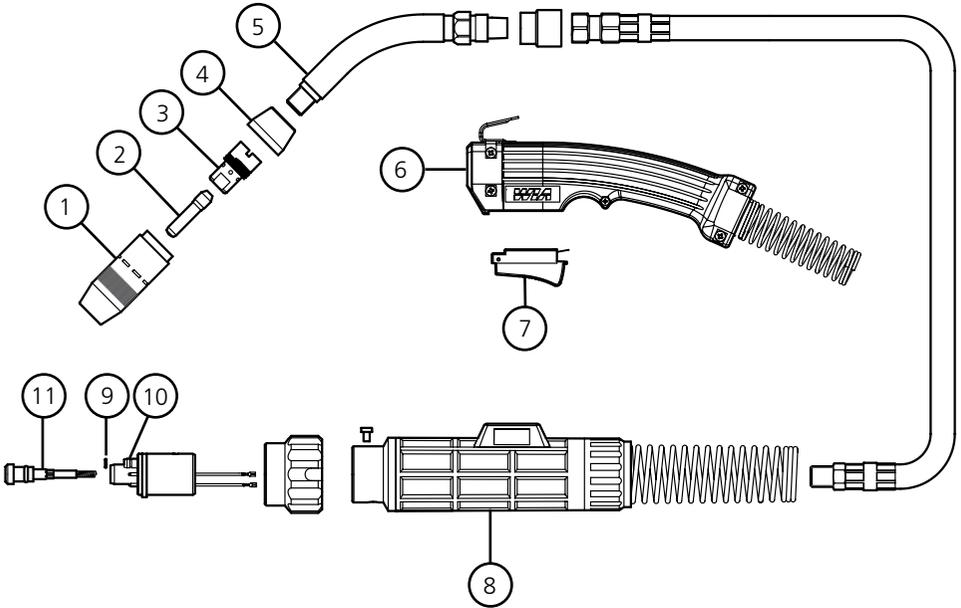


Fig 9 350 Amp Gun and Cable Assembly supplied with Weldmatic 350i
400 Amp Gun and Cable Assembly supplied with Weldmatic 500i

Item #	Part #	Description
1	see 'Nozzles' (page 16)	Nozzle
2	see 'Tips' (page 16)	Contact Tip
3	BED-1	Gas Diffuser, Large
4	BE10012	Insulator
5	BEQT3-45	Body Tube, 3", 45°
6	GUN002	Handle Kit (includes both halves, screws & trigger)
7	GUN003	Trigger Switch
8	GUN006	Rigid Casing
9	BE9165	Small "O" ring on gas nipple
10	BE4421	Large "O" ring at base of gas nipple
11	BEL3B-15 BE4154503N	Steel Liner 0.9-1.2mm, 300 amp Nylon Liner 0.9-1.2mm
	BEL3A-15	Steel Liner 0.9-1.2mm, 400 amp
	GUN004	350A Gun & Cable Assembly
	GUN008	400A Gun & Cable Assembly

Nozzles

Part #	Description
BEN-3400C	Nozzle, copper, 3/4" I.D , flush
BEN-3414B	Nozzle, brass, 3/4" I.D , 1/4" recess
BEN-3414C	Nozzle, copper, 3/4" I.D , 1/4" recess
BEN-3418B	Nozzle, brass, 3/4" I.D , 1/8" recess
BEN-5800C	Nozzle, copper, 5/8" I.D , flush
BEN-5814B	Nozzle, brass, 5/8" I.D , 1/4" recess
BEN-5814C	Nozzle, copper, 5/8" I.D , 1/4" recess
BEN-5818B	Nozzle, brass, 5/8" I.D , 1/8" recess
BEN-5818C	Nozzle, copper, 5/8" I.D , 1/8" recess

Tips

Wire diameter	Part #
0.8 mm	BET-030
0.9 mm	BET-035
1.0 mm	BET-039
1.2 mm	BET-045
1.4 mm	BET-052
1.6 mm	BET-062
2.0 mm	BET-078

To replace liner: Disconnect gun/cable assembly at the Euro adaptor. Remove nozzle (1), gas diffuser (3) and insulator (4). Withdraw old liner from the wirefeeder end. Insert new liner and refit gun/cable assembly to the wirefeeder.

At the gun end, compress the liner within the gun cable, then cut it **approx 20 mm past the end of the body tube/neck** (5) (the diameter of the gas diffuser is 20 mm and can be used as a guide) - see Figure 8.

Refit insulator and screw gas diffuser on firmly with a wrench.

Insert tip (2) into gas diffuser then thread nozzle onto gas diffuser/tip and tighten firmly by hand.

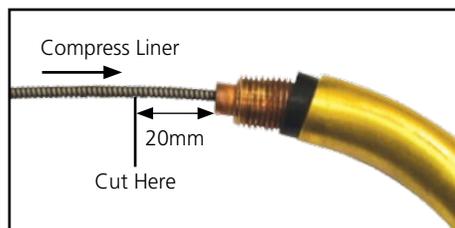


Fig 10 Replacing the gun cable liner

10.5 Assembly and Parts List - Work Lead & Interconnecting Lead Kit 350i

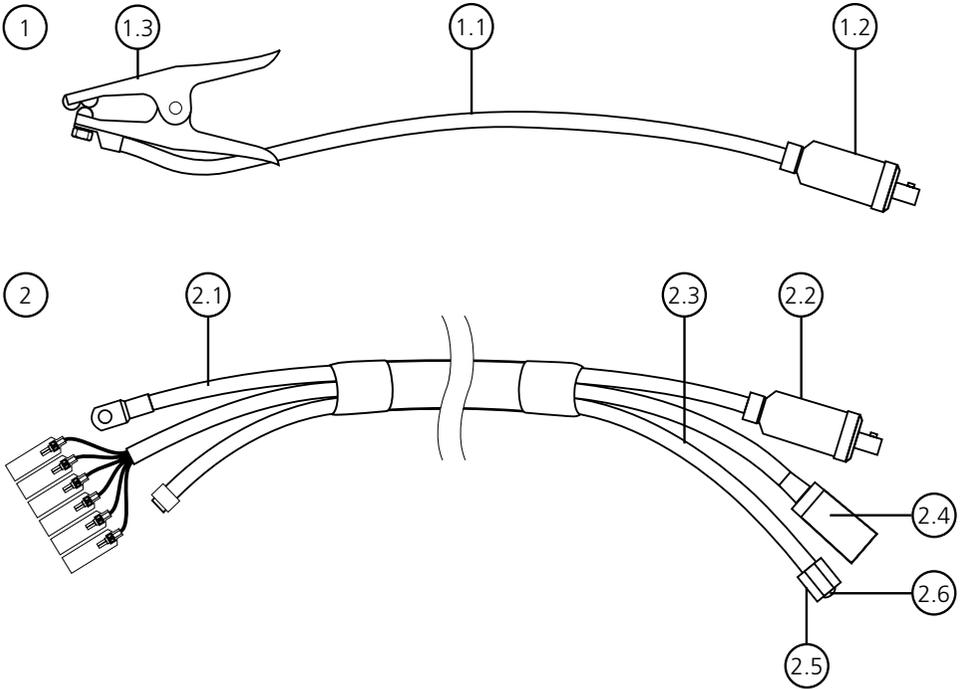


Fig 11 Work Lead & Interconnecting Lead Kit supplied with Weldmatic 350i

Item #	Part #	Description
1		Work Lead
Includes	1.1	Welding Cable, 35mm ²
	1.2	CX21 Plug, Dinse
	1.3	Work Clamp
2	AM360-1/10	10m Interconnecting Lead (Order AM361-1/10)
Includes	2.1	Welding Cable, 35mm ²
	2.2	CX21 Plug, Dinse
	2.3	62513 Gas Hose, 5mm
	2.4	E0087 Control Plug, 7 Pin
	2.5	TC267 Gas Nut
	2.6	TC268 Gas Tail (5mm)

10.5 Assembly and Parts List - Work Lead & Interconnecting Lead Kit 500i

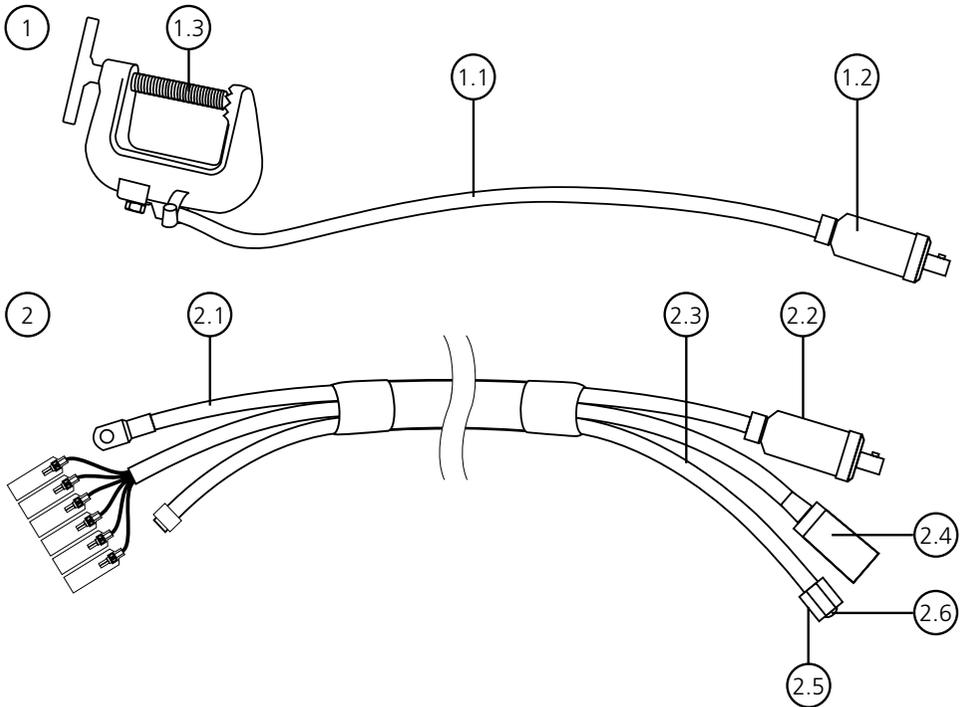


Fig 12 Work Lead & Interconnecting Lead Kit supplied with Weldmatic 500i

Item #	Part #	Description
1		Work Lead
Includes 1.1		Welding Cable, 50mm ²
1.2	CX21	Plug, Dinse
1.3	CLA001	Work Clamp, G Clamp Style
2	AM361-1/10	10m Interconnecting Lead
Includes 2.1		Welding Cable, 50mm ²
2.2	CX21	Plug, Dinse
2.3	62513	Gas Hose, 5mm
2.4	E0087	Control Plug, 7 Pin
2.5	TC267	Gas Nut
2.6	TC268	Gas Tail (5mm)

11 Warranty Information



WIA Weldmatic MIG Equipment Gold Shield Warranty Statement

Effective 1st February 2011

Welding Industries of Australia (WIA) warrants to the original retail purchaser that the Weldmatic welding machine purchased (Product) will be free from defects in materials and workmanship for a period of 3 years from the date of purchase of the Product by the customer. If a defect in material or workmanship becomes evident during that period, Welding Industries of Australia will, at its option, either:

- Repair the Product (or pay for the costs of repair of the Product); or
- Replace the Product.

In the event of such a defect, the customer should return the Product to the original place of purchase, with proof of purchase, or contact Welding Industries of Australia on 1300 300 884 to locate an authorised service agent.

Any handling and transportation costs (and other expenses) incurred in claiming under this warranty are not covered by this warranty and will not be borne by Welding Industries of Australia. Welding Industries of Australia will return the replacement product, if original found to be faulty, freight free to the customer.

This warranty covers the Weldmatic power source and wirefeeder only, and does not extend to the regulator, gun assembly or accessories included in the original purchase package.

The obligation of Welding Industries of Australia under this warranty is limited to the circumstances set out above and is subject to:

- The customer being able to provide proof of purchase of the Product and the purchase price paid for the Product;
- The relevant defect in materials or workmanship;
- The Product not having been altered, tampered with or otherwise dealt with by any person in a manner other than as intended in respect of the relevant Product; and
- The Product not having been used or applied in a manner that is contrary to customary usage or application for the relevant Product or contrary to any stated instructions or specification of Welding Industries of Australia.

Our goods come with guarantees that cannot be excluded under the Australian Consumer Law. You are entitled to a replacement or refund for a major failure and for compensation for any other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure. The benefits given by this warranty are in addition to other rights and remedies which may be available to the customer under any law in relation to goods and services to which this warranty relates.

Warranty provided by:
Welding Industries of Australia
(ABN 63 004 235 063)
A Division of ITW Australia Pty Ltd
5 Allan Street, Melrose Park,
South Australia, 5039

Ph: 1300 300 884
Email: info@welding.com.au
Web: www.welding.com.au

Miller Digital Elite Series™

AUTO-DARKENING HELMETS

Inferno P/N - 257217 Joker P/N - 257218

Lucky's Speed Shop P/N - 257214 Black P/N - 257213

FOUR MODES – WELD, CUT, GRIND & X-MODE



- Lens and helmet comply with Australian Standards AS/NZS 1338.1 (Auto-Darkening) and AS/NZS 1337.1 B (High Impact)
- Lightweight at only 510g.
- Improved digital controls.
- Battery powered with solar assist.

- Lightweight headgear.
- Four independent arc sensors.
- Suits MIG, Stick, Flux-Cored and Pulse.
- TIG rating 5 Amps.
- 3 year warranty (Auto-Darkening lens only).

For more information call 1300 300 884 or visit welding.com.au

