

17 MARCH, 1994

BULLETIN.039A

## SYNCHRO-PULSE CDT450: CP38-3 CP38-31/6 FUSE HOLDER

It has been noticed for early production of the CP38-3, that if the machine is being used for either Stick or TIG welding, the 20A 3AG fuse on the CP38-31 Transistor Drive Assy can open-circuit, indicating a 'Transistor Driver Power' fault.

The fuse generally melts 'open' rather than fusing. This is caused by overheating fuse holder clips.

To overcome this problem, replace the existing fuse holder.

\*Spare parts supplied by W.I.A. under part number CP38-31/6 are correctly rated for this application.