

14 JANUARY, 1992

BULLETIN.020


WELDMATIC 205S: CP102
CP102-11/02 TRIAC CONTROL PCB

Due to faulty artwork in early production PCB's, diode D1 was effectively shorted by an unwanted section of track. Modifications were done to the boards to enable them to be used in some early production runs.

On the rear of the PCB, two (2) sections of track were cut and a piece of hook-up wire was used to re-route the circuit.

14/1/92

CPI02-11/02 PCB

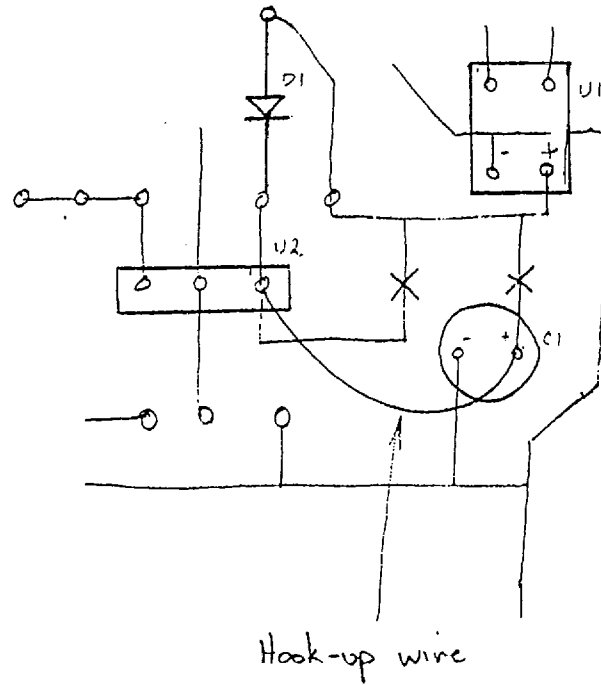

Fault: D1 diode shorted
by tracks

