

9 OCTOBER, 1995


BULLETIN.132

MOSA MSG201S FAILURE OF CIRCUIT BOARD 201499660

When the Mosa MG201S is to be used for 240V ac auxiliary power generation, the engine speed setting must be adjusted to approximately mid range, as indicated by the throttle markings.

It has been noted that if the speed is set in the maximum condition during use of auxiliary power, this will lead to failure of the inverter circuit board #201499660.

Boards which fail in this manner should not be treated as warranty claims.

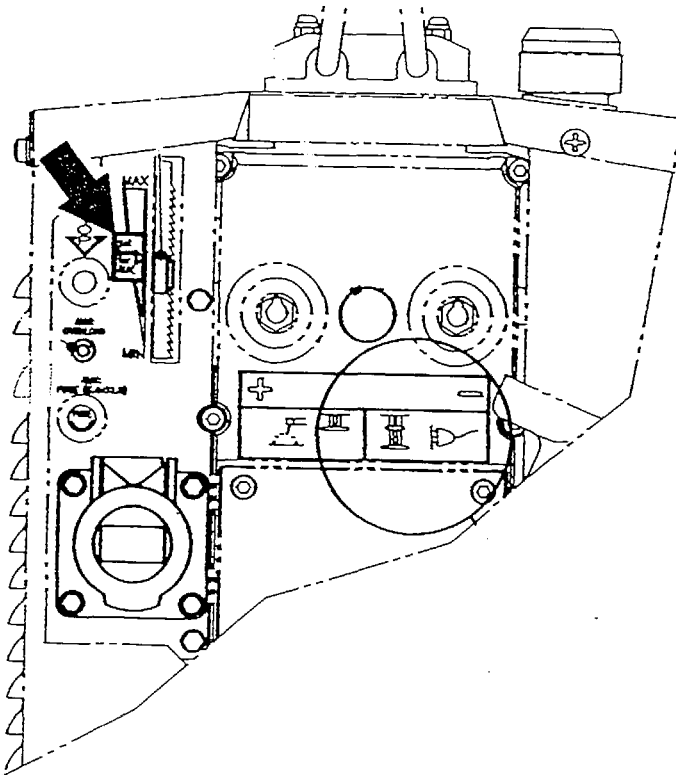

GARY L CHEESMAN
EQUIPMENT MARKETING MANAGER

QUALITY WELDING PRODUCTS, SYSTEMS & SERVICE

The information provided in this Data Sheet is accurate and reliable.

However no warranty of accuracy or reliability is given and no responsibility arising in any other way by errors or omissions is accepted.