


14 MARCH, 1995

BULLETIN.123

W34-0 WIREFEEDER

All W34-0 wirefeeders manufactured to date have been shipped without a burnback potentiometer fitted to the wirefeed control pcb. This results in very long burnback periods at end of weld.

The potentiometer required is a 50k trimpot, WIA part number W11-7/8. It should be installed in the vacant circuit position shown on the diagram below.

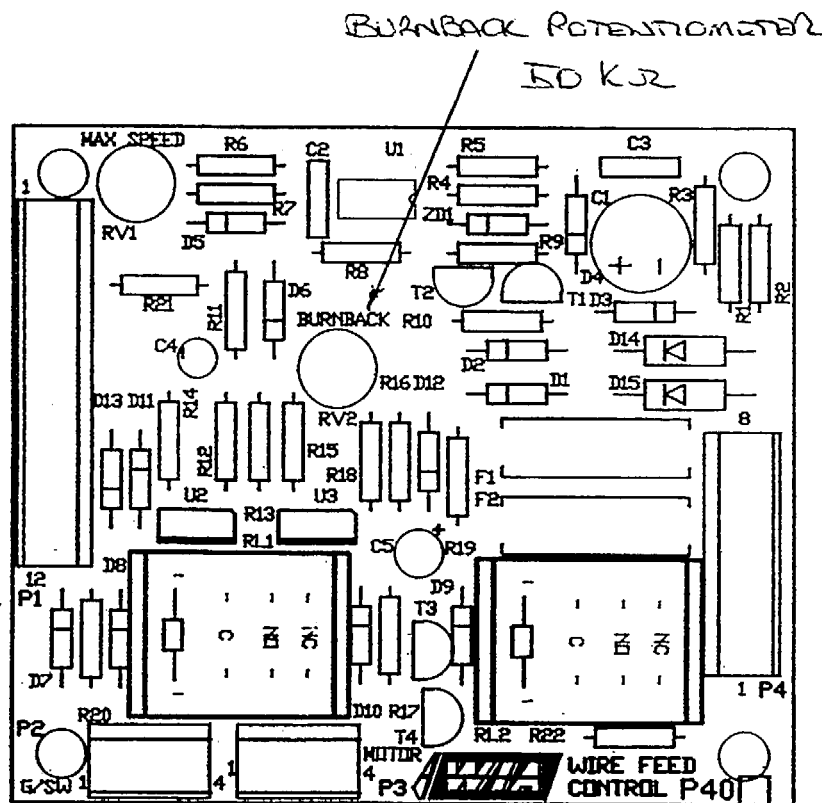

GC
GARY CHEESMAN
MARKETING MANAGER - EQUIPMENT