

27 August, 1998

BULLETIN #151


**SYNCHRO-PULSE CDT 450****DISPLAY EPROMS #38132-XX & #38146-19**

There have been a few reports where the operator has been locked out of his CDT 450 for some unknown reason. The problem was traced to Display EPROMs that have the version #38132-XX or #38146-19.

These EPROMs have a security/lock function that is not shown on the machine's display but can intermittently activate itself. To reset or to deactivate the security lock out, press UP, DOWN & ENTER keys on the display simultaneously for 10 seconds when powering on.

To eliminate the problem completely, the Display EPROM must be updated to the latest version - #38146/27. WIA part number for Display EPROM #38146/27 is CP38-3/51.

If you come across any other Display EPROMs exhibiting similar "lock out" problems, please advise me.

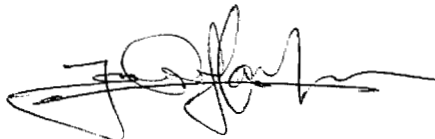

James Chin

Technical Service Co-ordinator - Marketing

---

**QUALITY WELDING PRODUCTS, SYSTEMS AND SERVICES**

---

The information provided in this sheet is accurate and reliable, however no warranty of accuracy or reliability is given and no responsibility arising in any other ways by errors or omissions is accepted