

14 MARCH, 1995

BULLETIN.121

HULFTEGGER LINER GUIDE SLEEVE

Difficulties have been reported where the Hulftegger nylon liner can slip out of the standard wire guide sleeve.


A modified sleeve has been successfully trialled which incorporates a threaded section. This item is screwed onto the liner, cutting its own thread, so making a firm fit.

The modified sleeve is part number HT667-136. Some stock is currently available.



GARY CHEESMAN
MARKETING MANAGER - EQUIPMENT

DRILL 3.5 DIA x 12 DEEP.
FROM THIS END, TO AVOID
BURRS IN INSIDE OF FITTING
TAP 3/16" BSW

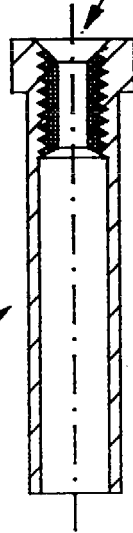

EXISTING PART
WIRE GUIDE SLEEVE
HT667-136

				WELDING INDUSTRIES OF AUSTRALIA 5 Allan Street, Melrose Park, S.A.5039	
				TITLE MODIFICATIONS TO WIRE GUIDE SLEEVE	
A	25/5/94	ek	ISSUE FOR MANUFACTURE	DRAWN MW	DRAWING No. HT667-136
ISSUE	DATE	CHK'D & APP'D	REVISION	DATE	
			THIRD ANGLE PROJECTION	25-5-94	
THIS DRAWING IS THE PROPERTY OF WELDING INDUSTRIES OF AUSTRALIA AND MUST NOT BE RETAINED, COPIED OR OTHERWISE USED WITHOUT PRIOR APPROVAL					